




(JIS マーク認証対象外)

差し込み溶接式高圧継手：(Oリング式) ユニオン

High Pressure Fittings with Socket Welding: O-Ring UNION

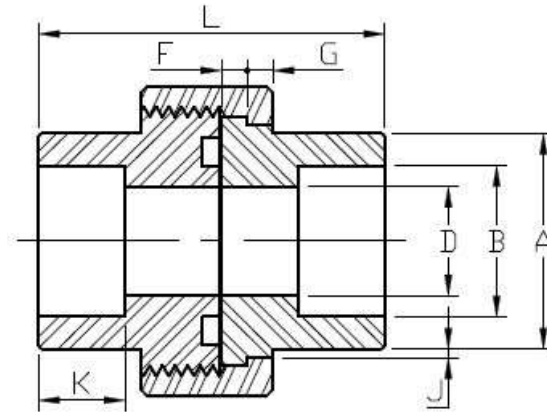

S80

単位：mm

径の呼び		外径 A (Min)	差し込み 部の内径 B	内径 D	メール フランジ F (Min)	ナット G (Min)	ベアリン グ J (Min)	差し込み 部の深さ K (Min)	長さ L
A	B								
DN	Nom. Pipe Size								
8	1/4	25.9	14.3	9.3	3.43	3.43	1.37	9.7	46.0
10	3/8	25.9	17.8	12.6	3.43	3.43	1.37	9.7	46.0
15	1/2	31.2	22.2	15.8	3.68	3.68	1.50	9.7	49.0
20	3/4	37.1	27.7	21.0	4.06	4.06	1.68	12.7	56.9
25	1	45.5	34.5	26.7	4.57	4.45	1.85	12.7	62.0
32	1-1/4	54.9	43.2	35.1	5.33	5.21	2.13	12.7	71.1
40	1-1/2	61.5	49.1	40.9	5.84	5.59	2.31	12.7	76.5
50	2	75.2	61.1	52.5	6.60	6.35	2.69	15.7	86.1